

Certificate of Calibration


Al Takamul Yard, North Rumailah South Iraq

• Phone : +964 7810009138 • www.qualitycontrol-iraq.com • E-mail: op@qualitycontrol-iraq.com

Date of Issue: September 8, 2025

REQUEST NUMBER : By Contract
JOB NUMBER : QC-CAL-25351
CERTIFICATE NUMBER : QC-CAL-25351-37

APPROVED BY: 

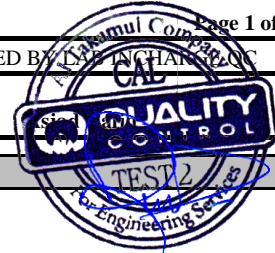

Page 1 of 1

CUSTOMER DETAILS

Name : slb Basra
Address : North Rumaila Base south Iraq
Department : Wireline

EQUIPMENT IDENTIFICATION AND SPECIFICATIONS

Description : Pressure Gauge
Manufacturer : NOV Elmar
Model : EN837-1
Serial Number : 210650539
Type : Analog
Location : Skid-14
Range : 0 to 3000 psi
Calibrated Range : 0 to 3000 psi
Resolution : 50 psi
Accuracy Class : 1.6
Tolerance : ±1.6 % of Full Scale
As found : In Tolerance
Calibrated By : Hussein Alaa
Calibration Date : September 8, 2025
Calibration Due : 07 September 2026



DEVIATION FROM STANDARD METHOD : None

REMARK (S) :

1. No adjustments were made prior to calibration.
2. Overload test was not performed.
3. No accessories were fitted.
4. Values were rounded in computation.

ENVIRONMENTAL CONDITIONS DURING TEST

Ambient Temperature : 25.0 ± 2°C **Humidity** : 30.0 ± 5 % RH **Atm. Pressure** : 1011.0 ± 10 hPa

CALIBRATION METHOD

The above equipment has been calibrated in accordance with Calibration Procedure QC/CP/R/03 Rev. 01
 The above instrument has been calibrated in increasing and decreasing pressure mode using a Digital Pressure Calibrator as the reference standard having traceability to Internationally recognised standards.

REFERENCE EQUIPMENT USED

DESCRIPTION	SERIAL NO.	MAKE / MODEL	CALIBRATION DATE	CALIBRATION DUE DATE
Digital Pressure Gauge	468802	AMETEK / XP2i	05 Nov, 2024	04 Nov, 2025

CALIBRATION TEST RESULTS

Measured Values on Unit Under Calibration (M)	Ref. Standard Values (A)	Deviation (D=M-A)	Error Percentage
psi	psi	psi	±
0	0.00	0.00	0.0
750	740.00	10.00	0.3
1500	1487.00	13.00	0.4
2250	2238.00	12.00	0.4
3000	2987.00	13.00	0.4

Calibration results were found to conform as per specified accuracy requirements. Above Instrument has **PASSED** its Calibration.

- The results are as found (no adjustment done).
 The results are post adjustment.