


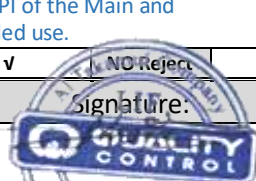

Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Aberdeen Technical Services	Certificate no:	QC-B-09-26-206/01										
Location:	Aberdeen Technical Services Yard	Job Order No:	QC-B-09-26-206										
Date of Examination:	27-Sep-2026	Next Inspection Date:	26-Sep-2027										
Equipment Serial No:	437187	Proof Load Test Date:	29-09-2023										
Safe Working Load (SWL):	55 ton	Last Inspection Date:	24-09-2025										
Description of Equipment	Diesel Operated Hydraulic Telescopic Boom Mobile Crane												
	Crane Max Capacity 55 Ton @ Minimum Radius 3.0 M & Minimum Boom Length 11.0 M & Full Parts of Line, Outriggers Fully Extended with Front Jack.												
	Manufacturer / Date: TADANO / 2018												
	Chassis No: KG48U-00002												
	Model: GT-550E-1-11205												
	Basic Boom Length: 11.1 m to 42.0 m												
	Max Radius: 3.0 m to 34.0 m												
	Main Hoist S/N: FT16-9-95 , SWL: 55 Ton												
	Wire rope: 19 mm												
	Auxiliary Hoist S/N: U1110215 , SWL: 4.5 Ton												
Wire rope: 19 mm													
Falls: 7 Parties of Lines at The Time of Inspection													
Registration No: A 91751 Basra													
Ref. Standard	BS 7121-3:2017+A1:2019												
Main Block	No. of Falls	Radius	Boom Length	SWL	Load Applied								
	7	9.0 m	18.8 m	14.3 Ton	14.2 Ton								
		10.0 m	18.8 m	13.5 Ton	Function Test								
		11.0 m	18.8 m	11.4 Ton	Function Test								
Aux. Line	1	16.0 m	34.3 m	4.2 Ton	Function Test								
Examination Type		Pass	Fail	Notes									
Operational (No Load)		☒		Mobile Crane Found Satisfactory for Further Use.									
Performance Test (Rated Capacity)		☒		Mobile Crane was found to be acceptable for lifting 100 % of the SWL.									
Proof Load Test (1.25 x Rated Capacity)		---		Proof Load Test Shall Be Done After any Repair/ Modification.									
Is this the first examination after installation or assembly at a new site or location?		YES		NO	☒	Was the examination carried out?							
						Within 6 months?	YES		NO	☒			
If the answer to the above question is YES, has the equipment been installed correctly?		YES		NO		Within 12 months?	YES	☒	NO				
						By an examination scheme?	YES	☒	NO				
						After the occurrence of exceptional circumstances?	YES		NO	☒			
Identification of any part found to have a defect which is or could become a danger to persons and a description of the defect: (If none, state NONE) None (The load indicator only displays the operational capacity)													
Is the above a defect that is of immediate danger to persons										YES	☒	NO	
Is the above a defect that is not yet, but could become a danger to persons: (If YES, state the date by which)													
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None													
Particulars of Any Tests Carried Out as Part of The Examination: (If None, State None)													
In light of the inspection findings, the subject Mobile Crane was inspected visually and operationally, and a Function test and MPI of the Main and auxiliary hook were performed. No defects were observed during testing. Hence, it was found satisfactory and fit for the intended use.													
Is This Equipment Safe to Operate?													
Yes, Accept ☒ NO Reject ☐													
LEEA & ASNT Level II Inspector Name:		Signature:		Authenticating This Report:		Signature:							
Mohamed Abdullah				Ashraf El Said									

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Aberdeen Technical Services.	Location:	Aberdeen Yard	Certificate No:	QC-B-09-26-206/02
Date of Examination:	27-Sep-2026	SWL:	55 ton	Serial No:	437187



Components	Satisfactory	Comments
Structure		
Structure & Data Plate	☒ Satisfactory	
Slew Bearing Turn Freely/ Mechanism	☒ Satisfactory	
Chassis	☒ Satisfactory	
Crane Tires & Nuts	☒ Satisfactory	
Outriggers		
Hoses	☒ Satisfactory	
Extension rams	☒ Satisfactory	
Interlocking system	☒ Satisfactory	
Connecting Bolts and pins	☒ Satisfactory	
Levelling system	☒ Satisfactory	
Paintwork	☒ Satisfactory	
Outrigger pads	☒ Satisfactory	
Boom		
Condition	☒ Satisfactory	
Hydraulic hoses	☒ Satisfactory	
Extension Rams	☒ Satisfactory	
Extension Interlocks	☒ Satisfactory	
Boom main hoist Ram	☒ Satisfactory	
Main hoist Ram footprint	☒ Satisfactory	
Jib, Boom, Boom Extension, Turret	N/A	
Counter Weight:		
Ballast weights pick up Rams	☒ Satisfactory	Fixed
Hydraulic hoses	N/A	
Operation	N/A	
Ballast weights	N/A	
Electrics		
Switchgear and panels	☒ Satisfactory	
Connections/wiring	☒ Satisfactory	
Operations	☒ Satisfactory	
Automatic Safe Load Indicators and Limit Switches		
Radius/ Boom/ Angle Indicators	☒ Satisfactory	
Safe Load Indicator & Overload Limit Switch	☒ Satisfactory	
Audible & Visual Alarms are operative	☒ Satisfactory	
Anti-Two-Block Switches Operation	☒ Satisfactory	
Position and visibility	☒ Satisfactory	
LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:
Mohamed Abdullah		Ashraf El Said

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

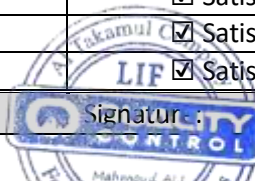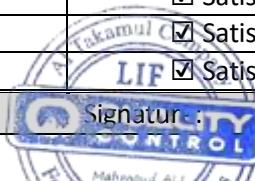Client Name:	Aberdeen Technical Co	Location	Aberdeen Yard	Certificate No:	QC-B-09-26-206/03
Date of Examination:	27-Sep-2026	SWL:	55 ton	Serial No:	437187
Components		Satisfactory		Comments	
Hydraulic System					
Flexible Hoses and Hose Connections		☑ Satisfactory			
Hydraulic Cylinder		☑ Satisfactory			
Hydraulic Cylinder Fittings		☑ Satisfactory			
Hydraulic Filter		☑ Satisfactory			
Pump Condition		☑ Satisfactory			
Oil Seepage/ Leakage		☑ Satisfactory			
Wire Ropes / Fittings / Hook Blocks / Sheaves/ Drum					
Wire Rope Condition		☑ Satisfactory			
Rope Reeving on Drum		☑ Satisfactory			
Drum Condition		☑ Satisfactory			
Main Hook Block		☑ Satisfactory			
Hook Safety Latch		☑ Satisfactory			
Sheaves		☑ Satisfactory			
Wedge Socket & Dead-End Anchorage Point		☑ Satisfactory			
Boom Angle Indicator		☑ Satisfactory			
Operator Cabin & General					
Cabin condition		☑ Satisfactory			
Visibility		☑ Satisfactory			
Seating		☑ Satisfactory			
Heat and ventilation		☑ Satisfactory			
Manufacturers rating charts		☑ Satisfactory			
Access and egress		☑ Satisfactory			
Control markings		☑ Satisfactory			
Control operation		☑ Satisfactory			
Windscreen wipers		☑ Satisfactory			
Fire Extinguisher Availability		☑ Satisfactory			
Operational Test					
Hoisting Up & Down		☑ Satisfactory			
Boom Extraction and Subtraction		☑ Satisfactory			
Boom Raising and Lowering		☑ Satisfactory			
Slewing Operation & Alarm		☑ Satisfactory			
Drum Operation		☑ Satisfactory			
Levers Operation (In Operator Cabin)		☑ Satisfactory			
Reverse Alarm & Operation		☑ Satisfactory			
Lights, Horn & Indicators		☑ Satisfactory			
LEEA & ASNT Level II Inspector Name:		Signature:		Authenticating This Report:	
Mohamed Abdullah				Ashraf El Said	
					

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Aberdeen Technical Co	Location	Aberdeen Yard	Certificate No:	QC-B-09-26-206/04
Date of Examination:	27-Sep-2026	SWL:	55 ton	Serial No:	437187

Test Methods:	Result	Comments
VT	☒ Accept	
MT	☒ Accept	MPI of Main Hook SN: FT16-9-95 MPI of Auxiliary Hook SN: U1110215
Functional Test	☒ Accept	
Performance Test	☒ Accept	
Proof Load Test {1.25 X SWL}	---	
Functional Test		
Carried out without load on all functions (including brakes and safety devices) and controls to check the correct and smooth equipment operation, free from wear and other damage.		
Performance Test		
Carried out after Functional Test and with the rated load (SWL) applied, where Hoist brakes were found satisfactory.		
Proof Load Test		
Carried out after Performance Test and with the 1.25 x (SWL) applied load, where Hoist brakes were found satisfactory.		

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdullah		Ashraf El Said	

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



Main Hoist Block & Whip line Sheaves
found satisfactory at the time of inspection

Crane wedge sockets & Wire Ropes Termination
found satisfactory at the time of inspection



Wire ropes & Drum Reeving Functions, Rollers, Sheaves,
found satisfactory at the time of inspection

Crane Level gauge & Levers Control,
found satisfactory at the time of inspection




Crane front piston & Outriggers,
found satisfactory at the time of inspection

LEEA & ASNT Level II Inspector Name:

Mohamed Abdullah

Signature:

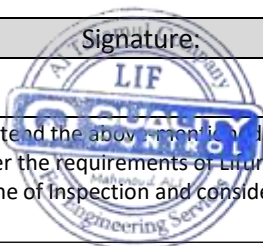

Authenticating This Report:

Ashraf El Said

Signature:



THIS IS TO CERTIFY THAT: a competent person did attend the above mentioned owner's work location on the date shown above, and the lifting equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



Crane Level gauge & Levers Control,
found satisfactory at the time of inspection



Main Block Hoisting & Whip line Hoisting,
Boom With Radius Reading Limit Switches.
All found satisfactory at the time of inspection



Boom Cylinder & Piping, Boom Sections,
found satisfactory at the time of inspection



Crane Data Plate & Chassis & Registration Plate
found satisfactory at the time of inspection



Crane Tyers found satisfactory at the time of inspection

LEEA & ASNT Level II Inspector Name:

Signature:

Authenticating This Report:

Signature:

Mohamed Abdullah

Ashraf El Said

THIS IS TO CERTIFY THAT: a competent person did attend the above mentioned owner's work location on the date shown above, and the lifting equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



Crane Load Chart
found satisfactory at the time of inspection



Main Hoist Block
found satisfactory at the time of inspection



Auxiliary Hoist
found satisfactory at the time of inspection



Main Hoist Block & Auxiliary Hoist Limit Switches Stopper
All found satisfactory at the time of inspection



Crane Load Indicator & Radius 9 m , Boom Length 18.8 m,
Load Chart SWL 14.3 Ton , Applied Load 14.2 Ton , As Per Load Chart, found satisfactory at the time of inspection

LEEA & ASNT Level II Inspector Name:

Signature:

Authenticating This Report:

Signature:

Mohamed Abdullah

Ashraf El Said

THIS IS TO CERTIFY THAT: a competent person did attend the above mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Equipment Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



Hydraulic level gauge
found satisfactory at the time of inspection



Mobile Crane All found satisfactory at the time of inspection



Q.1	الرقم	E	K04800002
Q.2	رقم الترخيص	11	2018
Q.3	اسم المالك	13	30
Q.4	0 kg	Q.5	0 kg
Q.6	210	Q.7	20 kg
Q.8	3	Q.9	20 kg
Q.10	3000 kW	Q.11	0 kg
Q.12	K0348U00002	Q.13	0 kg
Q.14	15	Q.15	0 kg
Q.16		Q.17	0 kg
Q.18		Q.19	0 kg
Q.20		Q.21	0 kg



LEEA & ASNT Level II Inspector Name:

Mohamed Abdullah

Signature:



Authenticating This Report:

Ashraf El Said

Signature:



THIS IS TO CERTIFY THAT: a competent person did attend the above mentioned owner's work location on the date shown above, and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.