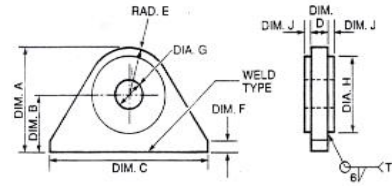





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-01
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
L1 L2	02	Fabricated Pad Eyes Mud system ladder SN: DQ22-MSL-01		2 Ton	30-12-2023
		Pad Eye Dimension Thickness: 22 MM Pin Hole: 32 MM Length: 100 MM Height: 85 MM			
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES	NO	✓	
If the answer to the above question is YES has the equipment been installed correctly?		YES	NO		
		Was the examination carried out: Within an interval of 6 months?		YES	✓
		With an interval of 12 months?		YES	NO
		In accordance with an examination scheme?		YES	✓
		After the occurrence of exceptional circumstances?		YES	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature:	Date of Next Through Examination:		
Mohamed Abdalla	Ashraf elsaid		27-12-2024		

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Equipment Operation & Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-01A
Unit Serial Number	Description of the examined equipment				Result
DQ22-MSL-01	Mud system ladder Lifting Pad Eyes				Pass
PAD EYES SN:	L1 , L2				



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

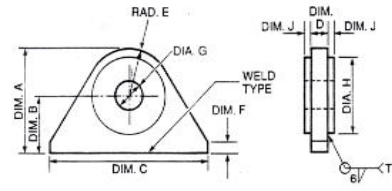




Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-02

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
L3 L4	02	Fabricated Pad Eyes Mud system ladder SN: DQ22-MSL-02 Pad Eye Dimension Thickness: 22 MM Pin Hole: 32 MM Length: 100 MM Height: 85 MM	2 Ton	30-12-2023
				

Reference Standard: LEEA DOC 048:2015

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within an interval of 6 months?	YES	NO	✓
					With an interval of 12 months?	YES	NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		In accordance with an examination scheme? After the occurrence of exceptional circumstances?	YES	NO	
					YES	NO	✓

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) N/A

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

IS THIS EQUIPMENT SAFE TO OPERATE? YES NO

NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

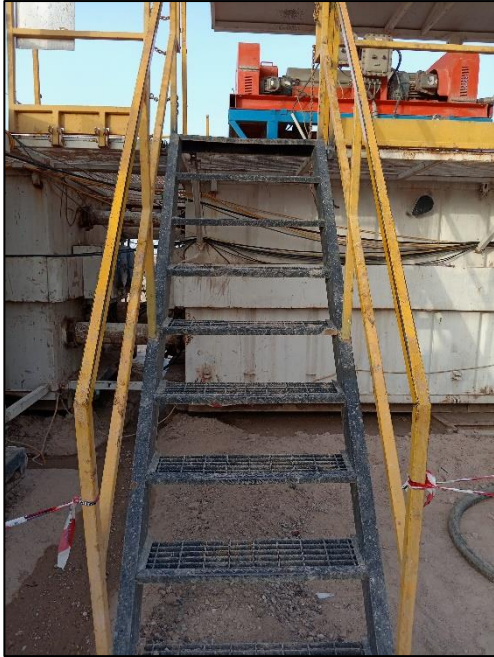
THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Equipment Operations and Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.






Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-02A
Unit Serial Number	Description of the examined equipment				Result
DQ22-MSL-02	Mud system ladder Lifting Pad Eyes				Pass
PAD EYES SN:	L3 , L4				



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

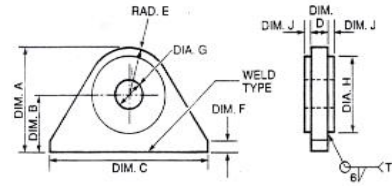

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-03
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
L5 L6	02	Fabricated Pad Eyes Mud system ladder SN: DQ22-MSL-03		2 Ton	30-12-2023
		Pad Eye Dimension Thickness: 22 MM Pin Hole: 32 MM Length: 100 MM Height: 85 MM			
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES	NO	✓	
If the answer to the above question is YES has the equipment been installed correctly?		YES	NO		
		Was the examination carried out: Within an interval of 6 months?		YES	✓
		With an interval of 12 months?		YES	NO
		In accordance with an examination scheme?		YES	✓
		After the occurrence of exceptional circumstances?		YES	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature:	Date of Next Through Examination:		
Mohamed Abdalla	Ashraf elsaid		27-12-2024		

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Equipment Operations and Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-03A
Unit Serial Number	Description of the examined equipment				Result
DQ22-MSL-03	Mud system ladder Lifting Pad Eyes				Pass
PAD EYES SN:	L5 , L6				



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-04

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
L7 L8 L9 L10 L11 L12	06	Fabricated Pad Eyes Support pad eyes for mud system ladder Pad Eye Dimension Thickness: 21 MM Pin Hole: 21 MM Length: 65 MM Height: 50 MM	1 Ton	30-12-2023

Reference Standard: LEEA DOC 048:2015

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within an interval of 6 months?	YES	NO	✓
					With an interval of 12 months?	YES	NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		In accordance with an examination scheme? After the occurrence of exceptional circumstances?	YES	NO	
					YES	NO	✓

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) N/A

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

IS THIS EQUIPMENT SAFE TO OPERATE? YES NO

NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Equipment Operation & Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report


Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-04A

Description of the examined equipment	Result
Support pad eyes for mud system ladder	Pass
PAD EYES SN:	L7,L8,L9,L10,L11,L12



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection
Identification of any part found to have a defect and a description of the defect:
None
Particulars of any repair, renewal or alteration required to remedy the defect identified above:
None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

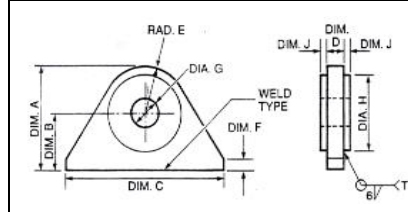

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-05
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
B1 B2 B3 B4	04	Fabricated Pad Eyes BELL NIPPLE BN-22		2 Ton	30-12-2023
		Pad Eye Dimension Thickness: 21 MM Pin Hole: 39 MM Length: 120 MM Height: 100 MM		Last Proof Load Test:- N/A	
					
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES	NO	Was the examination carried out: Within an interval of 6 months?	
				YES	
If the answer to the above question is YES has the equipment been installed correctly?		YES	NO	With an interval of 12 months?	
				YES	
				In accordance with an examination scheme?	
				YES	
				After the occurrence of exceptional circumstances?	
				YES	
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp		Date of Next Through Examination:	
Mohamed Abdalla	Ashraf elsaid			27-12-2024	

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.




Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-05A
Unit Serial Number	Description of the examined equipment				Result
BN-22	BELL NIPPLE PAD EYES				Pass
PAD EYES SN:	P1 , P2 , P3 , P4				



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

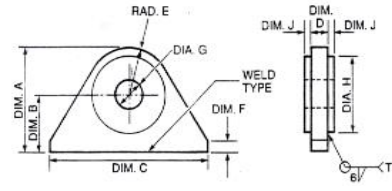

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-06
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
P5 P6 P7 P8	04	Fabricated Pad Eyes RISER R01 Pad Eye Dimension Thickness: 21 MM Pin Hole: 39 MM Length: 120 MM Height: 100 MM		6 Ton	22-11-2023
				Last Proof Load Test:- N/A	
					
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES	NO	YES	NO
If the answer to the above question is YES has the equipment been installed correctly?		YES	NO	YES	NO
Was the examination carried out: Within an interval of 6 months?		YES	NO	YES	NO
Was the examination carried out: Within an interval of 12 months?		YES	NO	YES	NO
In accordance with an examination scheme?		YES	NO	YES	NO
After the occurrence of exceptional circumstances?		YES	NO	YES	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:		
Mohamed Abdalla	Ashraf elsaid		27-12-2024		

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned own work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.



Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 22)	Job Number:	QC-DQ-06-24-0192
Date of Examination:	28-06-2024	Date of Report:	28-06-2024	Certificate No:	QC-DQ-06-24-0192-3-06A
Unit Serial Number	Description of the examined equipment				Result
R01	RISER PAD EYES				Pass
PAD EYES SN:	P5 , P6 , P7 , P8				



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	14-08-2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf elsaid		27-12-2024

REV: 01 Dated: 20 June 2022

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned own location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

