


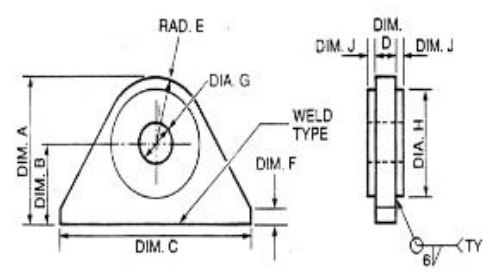


Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029
Certificate No:	QC-HH-07-0201-02/79		
Serial Number:	QTY	Description	SWL Each Pad Eye:
P1	01	Fabricated Pad Eyes O.D.S Back Up Post Pad Eyes Pad Eye Dimension Thickness: 28 mm Pin Hole: 51 mm Length: 110 mm Height: 120 mm	2 Ton
			Date of last Thorough examination
			06.01.2024
			
Reference Standard:		LEEA DOC 048:2015	
Is this the first examination after Installation or assembly at a new site or location?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	Was the examination carried out: Within an interval of 6 months? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> With an interval of 12 months? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> In accordance with an examination scheme? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> After the occurrence of exceptional circumstances? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
If the answer to the above question is YES has the equipment been installed correctly?		YES <input type="checkbox"/> NO <input type="checkbox"/>	YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE			
Is the above a defect which is of immediate danger to persons:			YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)			YES by:
Particulars of any repair, renewal or alteration required to remedy the defect identified above:			
Particulars of any tests carried out as part of the examination: (If none state NONE) VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY			
IS THIS EQUIPMENT SAFE TO OPERATE?			YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>
NDT Equipment Details			
Standard	ASTM E709	Viewing Condition:	Colored Media
Yoke	Permanent	Serial No:	PY-011
White Contrast	WCP-2	Batch No:	220602
Black Ink	7HF	Batch No:	220605
Method	WET		
Due Date	12.08.2024		
Due Date	06-2025		
Due Date	7-1-2025		
NDT procedure			
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection			
Identification of any part found to have a defect and a description of the defect:			
None			
Particulars of any repair, renewal or alteration required to remedy the defect identified above:			
None			
ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf Alsaid		13.01.2025

REV: 01 Dated: 20 June 2022






Visual & Magnetic Particles Examination Report

Client Name:	Hong Hua Oil & Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029
Certificate No:	QC-HH-07-0201-03/80		
Serial Number	Description of the examined equipment		Result
DZ1-30	O.D.S Back Up Post Pad Eyes		Pass
Pad Eyes Serial Number	P1	SWL Each Pad Eye:	2 Ton



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf Alsaid		13.01.2025

REV: 01 Dated: 20 June 2022





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hong Hua Oil& Gas Engineering Services Ltd			Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029	Certificate No:	QC-HH-07-0201-02/81
Serial Number:	QTY	Description	SWL Each Pad Eye:	Date of last Thorough examination	
P2	01	Fabricated Pad Eyes D.S Back Up Post Pad Eyes Pad Eye Dimension Thickness: 28 mm Pin Hole: 51 mm Length: 110 mm Height: 120 mm	2 Ton	06.01.2024	
Reference Standard:			LEEA DOC 048:2015		
Is this the first examination after Installation or assembly at a new site or location?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	Was the examination carried out: Within an interval of 6 months?		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>
If the answer to the above question is YES has the equipment been installed correctly?		YES <input type="checkbox"/> NO <input type="checkbox"/>	With an interval of 12 months? In accordance with an examination scheme?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
			After the occurrence of exceptional circumstances?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				YES by:	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
Particulars of any tests carried out as part of the examination: (If none state NONE) VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>	
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-011	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:		
Mohamed Abdalla	Ashraf Alsaid		13.01.2025		


REV: 01 Dated: 20 June 2022






Visual & Magnetic Particles Examination Report

Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029
Serial Number	Description of the examined equipment		Result
DZ1-31	D.S Back Up Post Pad Eyes		Pass
Pad Eyes Serial Number	P2	SWL Each Pad Eye:	2 Ton

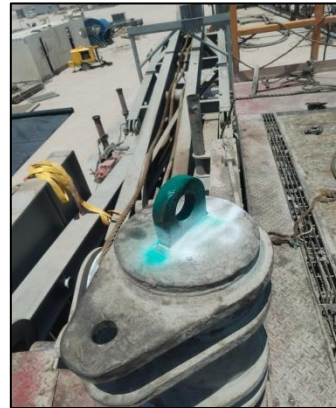

NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf Alsaid		13.01.2025



REV: 01 Dated: 20 June 2022





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

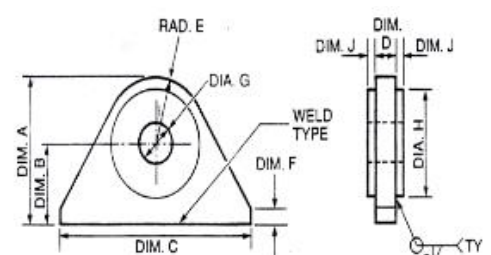Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01		
Date of Examination:	14.07.2024	Location:	HH Rig 029		
Certificate No:	QC-HH-07-0201-02/83				
Serial Number:	QTY	Description	SWL Each Pad Eye:		
P3	01	Fabricated Pad Eyes D.S Back Up Power Tong Post Pad Eyes Pad Eye Dimension Thickness: 18 mm Pin Hole: 30 mm Length: 60 mm Height: 60 mm	2 Ton		
		Date of last Thorough examination			
		06.01.2024			
					
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	Was the examination carried out: Within an interval of 6 months? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> With an interval of 12 months? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> In accordance with an examination scheme? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> After the occurrence of exceptional circumstances? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		
If the answer to the above question is YES has the equipment been installed correctly?		YES <input type="checkbox"/> NO <input type="checkbox"/>	YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:			YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)			YES by:		
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
Particulars of any tests carried out as part of the examination: (If none state NONE) VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY					
IS THIS EQUIPMENT SAFE TO OPERATE?			YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>		
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-011	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:		Authenticating This Report:		Signature & Stamp:	
Mohamed Abdalla		Ashraf Alsaid			
				13.01.2025	


REV: 01 Dated: 20 June 2022






Visual & Magnetic Particles Examination Report

Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029
Certificate No:	QC-HH-07-0201-03/84		
Serial Number	Description of the examined equipment		Result
DZ1-32	D.S Back Up Power Tong Post Pad Eyes		Pass
Pad Eyes Serial Number	P3	SWL Each Pad Eye:	2 Ton

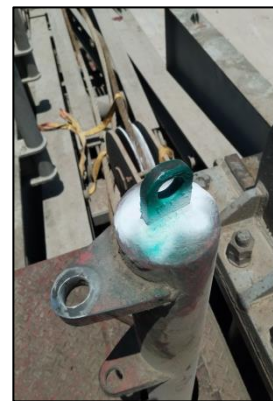

NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf Alsaid		13.01.2025



REV: 01 Dated: 20 June 2022





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

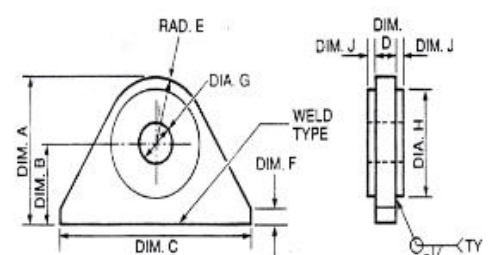Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01		
Date of Examination:	14.07.2024	Location:	HH Rig 029		
Certificate No:	QC-HH-07-0201-02/85				
Serial Number:	QTY	Description	SWL Each Pad Eye:		
50-1	01	Fabricated Pad Eyes O.D.S Back Up Power Tong Post Pad Eyes Pad Eye Dimension Thickness: 25 mm Pin Hole: 30 mm Length: 115 mm Height: 103 mm	2 Ton		
			Date of last Thorough examination		
			06.01.2024		
					
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	Was the examination carried out: Within an interval of 6 months? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> With an interval of 12 months? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> In accordance with an examination scheme? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> After the occurrence of exceptional circumstances? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		
If the answer to the above question is YES has the equipment been installed correctly?		YES <input type="checkbox"/> NO <input type="checkbox"/>			
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:			YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)			YES by:		
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
Particulars of any tests carried out as part of the examination: (If none state NONE) VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY					
IS THIS EQUIPMENT SAFE TO OPERATE?			YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>		
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-011	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:		Authenticating This Report:		Signature & Stamp:	
Mohamed Abdalla		Ashraf Alsaid			
				Date of Next Through Examination:	
				13.01.2025	

REV: 01 Dated: 20 June 2022






Visual & Magnetic Particles Examination Report

Client Name:	Hong Hua Oil& Gas Engineering Services Ltd	Job Number:	QC-HH-07-0201-01
Date of Examination:	14.07.2024	Location:	HH Rig 029
Certificate No:	QC-HH-07-0201-03/86		
Serial Number	Description of the examined equipment		Result
DZ1-33	D.S Back Up Power Tong Post Pad Eyes		Pass
Pad Eyes Serial Number	50-1	SWL Each Pad Eye:	2 Ton



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	12.08.2024
White Contrast	WCP-2	Batch No:	220602	Due Date	06-2025
Black Ink	7HF	Batch No:	220605	Due Date	7-1-2025
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Authenticating This Report:	Signature & Stamp:	Date of Next Through Examination:
Mohamed Abdalla	Ashraf Alsaid		13.01.2025

REV: 01 Dated: 20 June 2022

