

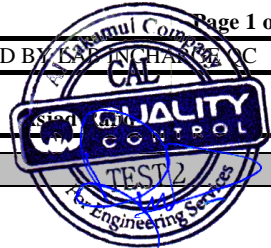
Certificate of Calibration

Al Takamul Yard, North Rumailah South Iraq

• Phone : +964 7810009138 • www.qualitycontrol-iraq.com • E-mail: op@qualitycontrol-iraq.com

Date of Issue: September 14, 2024

Page 1 of 1

REQUEST NUMBER : By Contract	APPROVED BY: 
JOB NUMBER : QC/JN/24/00353	
CERTIFICATE NUMBER : QC240914-08	

CUSTOMER DETAILS

Name : **slb Basra**
 Address : North Rumaila Base south Iraq
 Department : Coil Tubing

EQUIPMENT IDENTIFICATION AND SPECIFICATIONS

Description : **Pressure Gauge**
 Manufacturer : WIKA
 Model : NA
 Serial Number : CAL-PG-08
 Type : Analog
 Location : Unit (MPF34212Y1227)
 Range : 0 to 160 psi
 Calibrated Range : 0 to 160 psi
 Resolution : 2 psi
 Accuracy Class : 1.0
 Tolerance : 1 % of Full Scale
 As found : In Tolerance
 Calibrated By : Hussein Alaa
 Calibration Date : September 14, 2024
Calibration Due : 13 September 2025



DEVIATION FROM STANDARD METHOD : None

REMARK (S) :

1. No adjustments were made prior to calibration.
2. Overload test was not performed.
3. No accessories were fitted.
4. Values were rounded in computation.

ENVIRONMENTAL CONDITIONS DURING TEST

Ambient Temperature : 25.0 ± 2°C Humidity : 44.0 ± 5 % RH Atm. Pressure : 1011.0 ± 10 hPa

CALIBRATION METHOD

The above equipment has been calibrated in accordance with Calibration Procedure QC/CP/R/05 Rev. 01
 The above instrument has been calibrated in increasing and decreasing pressure mode using a Digital Pressure Calibrator as the reference standard having traceability to Internationally recognised standards.

REFERENCE EQUIPMENT USED

DESCRIPTION	SERIAL NO.	MAKE / MODEL	CALIBRATION DATE	CALIBRATION DUE DATE
Digital Pressure Gauge	468802	AMETEK / XP2i	20 Nov, 2023	19 Nov, 2024

CALIBRATION TEST RESULTS

Measured Values on Unit Under Calibration (M)	Ref. Standard Values (A)	Deviation (D=M-A)	Error Percentage
psi	psi	psi	±
0	0.00	0.00	0.0
40	40.5	-0.50	-0.3
80	80.3	-0.30	-0.2
120	120.4	-0.40	-0.3
160	160.2	-0.20	-0.1

Calibration results were found to conform as per specified accuracy requirements. Above Instrument has **PASSED** its Calibration.

- The results are as found (no adjustment done).
- The results are post adjustment.