

**AI TAKAMUL COMPANY FOR ENGINEERING TESTS
AND PROFESSIONAL SAFETY LIMITED**
Basra, North Rumaila, Quality Control Yard - Iraq



CERTIFICATION OF VISUAL, THOROUGH EXAMINATION & MAGNETIC PARTICLE INSPECTION

Client:	HALLIBURTON (HPS)	Report No:	QC-24-10-HPS-NDT-035A	
Location:	WQ1-562	JOB NO:	181024	
Inspection Date:	Tuesday, October 22, 2024	Next Inspection Date:	Monday, April 21, 2025	
Type Of Inspection:	VISUAL , THOROUGH EXAMINATION & MAGNETIC PARTICLE INSPECTION		Specification:	ASTM E709 & ASTM E 1444 (2016) ASME V Article 7 (2019)
		UNIT DESCRIPTION:	FRAC TANK LIFTING LUGS	
		UNIT S/N:	13253285	
		UNIT DIM:	14.20 M (L) X 2.90 M (W) X 4.40 M (H)	
		INSPECTION RESULT :		
		VISUAL , THOROUGH EXAMINATION	unit fully inspected and found free from deforms, cracks, corrosion & mechanical damage	
MAGNETIC PARTICLE INSPECTION	Welds & forgn areas inspected and found free from cracks and other defects			
FINAL RESULTS	THE ABOVE INSPECTED AREAS WAS ACCEPTED			
COMMENT:				
Magnetic Particle Inspection With A/C Hand Yoke , Black & White Contrast				

EQUIPMENT DETAILS						PERSON DETAILS		REVIEW BY	
Equipment:	AC-Yoke Test Block	Equipment:	Digital Lux Meter	Equipment:	AC/DC Yoke	INSPECTOR NAME: ASHRAF ELSAID QUALIFICATION: ASNT LEVEL II MT & PT & VT STAMP & SIGNATURE:	SENIOR INSPECTOR: MOHAMED ABDALLAH SUPERVISOR: HANI ALI CLIENT:		
S.No:	1657	S.No:	2722003	S.No:	201504052				
Cal Due Date:	11-Apr-25	Cal Due Date:	13-Apr-25	Cal Due Date:	11-Apr-25				
Black Magnetic Ink Manufacture:	Magnaflux	Batch No:	220605	Expiry Date:	JULY.2025				
Whie Contrast Paint Manufacture:	Magnaflux	Batch No:	220602	Expiry Date:	JUN,2025				
Technical Details:	Magnetic Partical Concentration		Method		WMPT Light Intensity				
	1.2 to 2.4 ml/100 ml		Wet Magnetic Particle Testing (WMPT)		3670 Lux				

Original - Client Files Copy - Area Office QC/FN/MPI/065 Rev.00 DATED 07 NOV 2021



Address; Noth Rumaila, AI Takamul Yard
Contact: +9647810009138

Tel: +9647810009138 / +9647834964657
Email: OP@qualitycontrol-iraq.com / hany.akafi@qualitycontrol-iraq.com

AI TAKAMUL COMPANY FOR ENGINEERING TESTS AND PROFESSIONAL SAFETY LIMITED

Basra, North Rumaila, Quality Control Yard - Iraq




CERTIFICATE OF QUALIFICATION VISUAL INSPECTION AND LEAK TESTING

THIS REPORT COMPLIES WITH RECOGNIZED INTERNATIONAL STANDARDS & TECHNICAL REQUIREMENTS

CLIENT:	HALLIBURTON (HPS)	REPORT No.:	QC-24-10-HPS-VT & LEAK -35B
LOCATION:	WQ1-562	STANDARD:	CUSOMER SPECIFICATION
INSPECTION DATE:	Tuesday, October 22, 2024	NEXT INSPECTION DATE	Monday, April 21, 2025
TYPE OF INSPECTION:	*VISUAL INSPECTION AND *LEAK TESTING		
DESCRIPTION:	FRAC TANK	SAP NO:	13253285
MEDIUM USED:	WATER	HOLDING TIME:	15 MINUTES

PICTURES

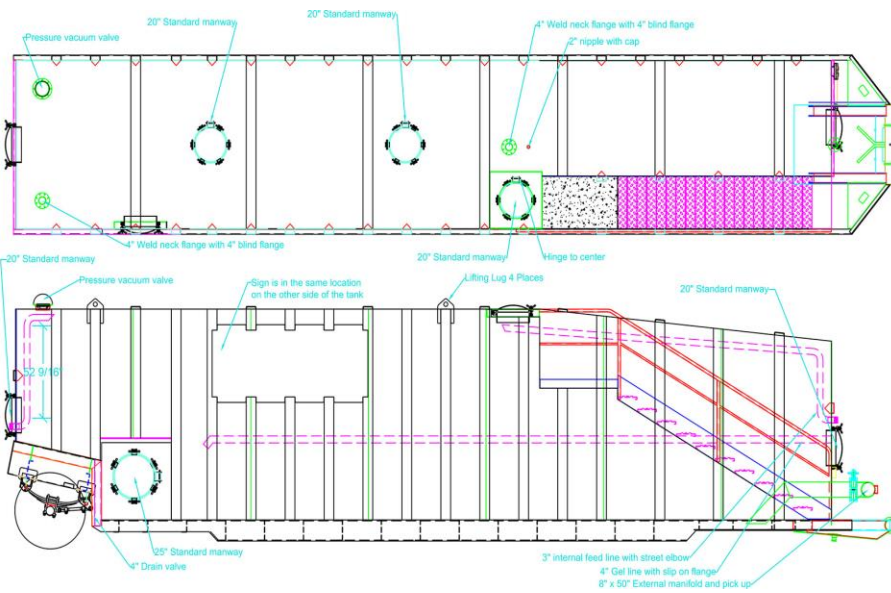

INSPECTION RESULT

VISUAL TESTING:	Visual Testing of Frac Tank did not found Deforms Mechanical Damage, Cracks and Corrosion. At time of Inspection.
LEAK TESTING:	Leak Testing of Frac Tank did not found any leakage during the holding time. At time of Inspection.

Inspection Evaluation

VISUAL TESTING-The above mentioned Frac Tank was found "Satisfactory" Fit for intended used.

LEAK TESTING- The above mentioned Frac Tank was found "Satisfactory" Fit for intended used.

PERSONNEL DETAILS		REVIEW BY	
INSPECTOR NAME: ASHRAF ELSAID		SENIOR INSPECTOR:	MOHAMED ABDALLAH
QUALIFICATION: ASNT LEVEL II MT,PT,VT		SUPERVISOR:	HANI ALI
STAMP & SIGNATURE:		CUSTOMER NAME	

Original - Client Files Copy - Area Office QC/FN/MP/065 Rev.00 DATED 07 NOV 2021



Tel: +9647810009138 / +9647834964657
 Email: OP@qualitycontrol-iraq.com
 hany.akafi@qualitycontrol-iraq.com