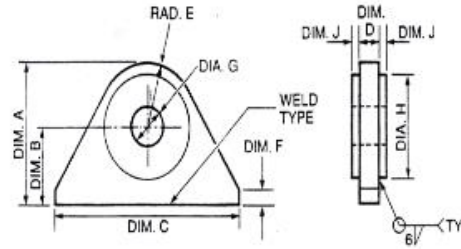




Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-HH-01-25-023/07
Location:	HH Rig 008	Job Order No:	QC-HH-01-25-023
Date of Examination:	23-February -2025	Next Inspection Due:	22-August-2025

Serial Number:	QTY	Description	Pad Eye SWL:	Date of last Thorough examination
DP-03 DP-04	02	Fabricated Pad Eye (Bop Lifting Clamp Pad Eyes) Pad Eye Dimension Thickness: 60 mm Pin Hole: 65 mm Length: 180 mm Height: 235 mm	25 Ton	N/A
				

Reference Standard: LEEA DOC 048:2015

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	v	Was the examination carried out: Within 6 months?	YES	v	NO	
					With an interval of 12 months?	YES		NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		By an examination scheme?	YES	v	NO	
				After the occurrence of exceptional circumstances?	YES		NO	v

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO v

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) YES by: _____

Particulars of any repair, renewal, or alteration required to remedy the defect identified above: _____

Particulars of any tests carried out as part of the examination: (If none state NONE)
VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY

IS THIS EQUIPMENT SAFE TO OPERATE? YES v NO

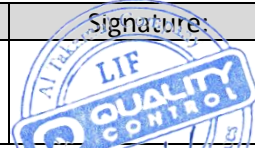

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2026
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2026

NDT procedure

Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: None

Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Khaled Mahmoud		Mohamed Abdulla	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.







Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-HH-01-25-023/08
Location:	HH Rig 008	Job Order No:	QC-HH-01-25-023
Date of Examination:	23-February -2025	Next Inspection Due:	22-August-2025
Unit Serial Number	Description of the examined equipment		Result
1222 1223	Bop Lifting Clamp Pad Eyes		Accept
Pad Eyes SN:	DP-03, DP-04	Each Pad Eyes SWL:	25 Ton



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2026
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2026
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					
All MPI was performed per OEM's instructions, and OEM did the measurements.					

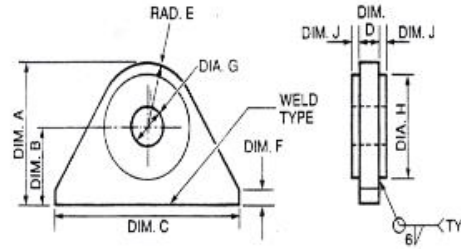
LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Khaled Mahmoud		Mohammed Abdulla	



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-HH-01-25-023/09
Location:	HH Rig 008	Job Order No:	QC-HH-01-25-023
Date of Examination:	23-February -2025	Next Inspection Due:	22-August-2025

Serial Number:	QTY	Description	Pad Eye SWL:	Date of last Thorough examination
LP-01 LP-02	02	Fabricated Pad Eye (Bop Lifting Clamp Pad Eyes) Pad Eye Dimension Thickness: 60 mm Pin Hole: 65 mm Length: 180 mm Height: 235 mm	25 Ton	N/A
				

Reference Standard:	LEEA DOC 048:2015
----------------------------	-------------------

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	v	Was the examination carried out: Within 6 months?	YES	v	NO
				With an interval of 12 months?	YES		NO
				By an examination scheme?	YES	v	NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		After the occurrence of exceptional circumstances?	YES		NO

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) **NONE**

Is the above a defect which is of immediate danger to persons:	YES	NO	v
--	-----	----	---

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) YES by:



Particulars of any repair, renewal, or alteration required to remedy the defect identified above:

Particulars of any tests carried out as part of the examination: (If none state NONE)
VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY

IS THIS EQUIPMENT SAFE TO OPERATE?	YES	v	NO
---	-----	---	----

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2026
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2026

NDT procedure
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection
Identification of any part found to have a defect and a description of the defect: None
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Khaled Mahmoud		Mohamed Abdulla	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.




Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-HH-01-25-023/10
Location:	HH Rig 008	Job Order No:	QC-HH-01-25-023
Date of Examination:	23-February -2025	Next Inspection Due:	22-August-2025
Unit Serial Number	Description of the examined equipment		Result
BL-2102-1810-01 BL-2102-1810-02	Bop Lifting Clamp Pad Eyes		Accept
Pad Eyes SN:	LP-01, LP-02	Each Pad Eyes SWL:	25 Ton



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2026
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2026
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					
All MPI was performed per OEM's instructions, and OEM did the measurements.					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Khaled Mahmoud		Mohammed Abdulla	