


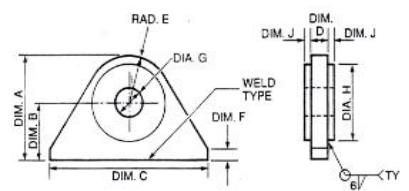


Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090	
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-55	
Serial Number:	QTY	Description		SWL	Date of last Thorough examination	
JJ061 JJ062 JJ063 JJ064	04	Fabricated Pad Eyes A FRAME SUPPORT BEAM Pad Eye Dimension Thickness: 25 MM Pin Hole: 40 MM Length: 230 MM Height: 162 MM		100 KN	19-10-2024	
				Last Proof Load Test:- N/A		
						
Reference Standard:	LEEA DOC 048:2015					
Is this the first examination after Installation or assembly at a new site or location?	YES	NO	Was the examination carried out: Within an interval of 6 months? With an interval of 12 months? In accordance with an examination scheme? After the occurrence of exceptional circumstances?			
		✓				YES
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO				
		✓				YES
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) NONE						
Is the above a defect which is of immediate danger to persons:					YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)					N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:						
IS THIS EQUIPMENT SAFE TO OPERATE?					YES	NO
NDT Equipment Details						
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET	
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025	
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026	
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026	
NDT procedure						
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection						
Identification of any part found to have a defect and a description of the defect:						
None						
Particulars of any repair, renewal or alteration required to remedy the defect identified above:						
None						

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660
 Email: / Admin@qualitycontrol-iraq.com
 QC-QA-MT-013 Rev.02Date SEP-2024





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-55A
Unit Serial Number	Description of the examined equipment				Result
20019	A FRAME SUPPORT BEAM PAD EYES				Pass
PAD EYES SN:	JJ061 , JJ062 , JJ063 , JJ064				



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660

Email: / Admin@qualitycontrol-iraq.com


QC-QA-MT-013 Rev.02Date SEP-2024






Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

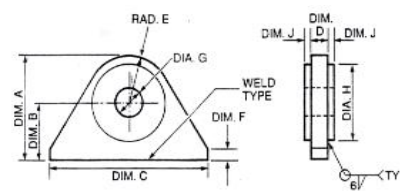Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-56
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
F1 F2 F3 F4 F5 F6 F7 F8	08	Fabricated Pad Eyes A FRAME SUPPORT BEAM Pad Eye Dimension Thickness: 11 MM Pin Hole: 29 MM Length: 90 MM Height: 100 MM		1 TON	19-10-2024
				Last Proof Load Test:- N/A	
					
Reference Standard:	LEEA DOC 048:2015				
Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within an interval of 6 months?	
				YES	NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		Was the examination carried out: With an interval of 12 months?	
				YES	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) NONE	YES	NO		In accordance with an examination scheme?	
				YES	NO
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025


THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.






Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-56A
Unit Serial Number	Description of the examined equipment				Result
20019	A FRAME SUPPORT BEAM PAD EYES				Pass
PAD EYES SN:	F1 , F2 , F3 , F4 , F5 , F6 , F7 , F8				

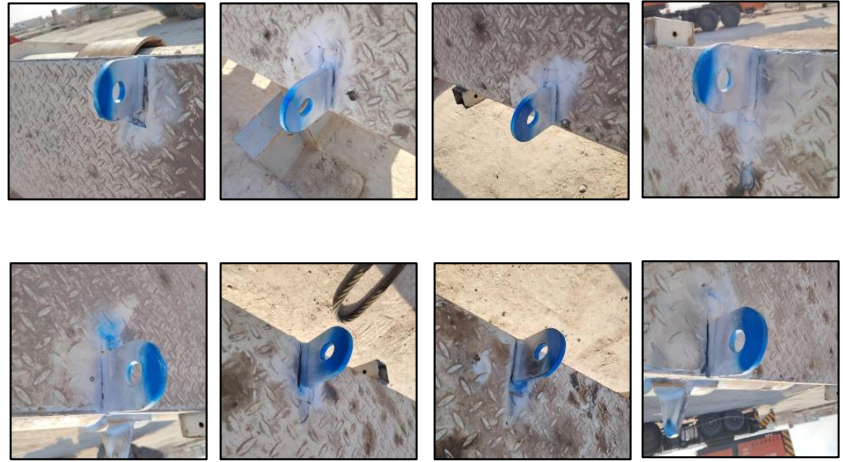

NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.


Contact Us: +9647810009138 +9647834964660
 Email: / Admin@qualitycontrol-iraq.com
 QC-QA-MT-013 Rev.02Date SEP-2024






Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

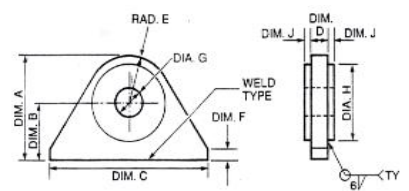Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-57
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
JJ071 JJ037	02	Fabricated Pad Eyes DRILL SIDE & OFF DRILL SIDE A FRAME SUPPORT BEAM		30 KN	19-10-2024
				Last Proof Load Test:- N/A	
Pad Eye Dimension Thickness: 19 MM Pin Hole: 33 MM Length: 450 MM Height: 220 MM					
Reference Standard:	LEEA DOC 048:2015				
Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within an interval of 6 months?	
				YES	NO
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		With an interval of 12 months?	
				YES	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) NONE	YES	NO		In accordance with an examination scheme?	
				YES	NO
Is the above a defect which is of immediate danger to persons:			YES	NO	✓
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)			N/A		
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?			YES	NO	✓
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.






Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-57A
Unit Serial Number	Description of the examined equipment				Result
20019	DRILL SIDE & OFF DRILL SIDE A FRAME SUPPORT BEAM PAD EYES				Pass
PAD EYES SN:	JJ071 , JJ037				



NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect:	
None	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:	
None	

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-58
Unit Serial Number	Description of the examined equipment				Result
20019	DRILL SIDE & OFF DRILL SIDE A FRAME SUPPORT BEAM LIFTING LUGS				Pass
PAD EYES SN:	P1 , P2 , P3 , P4				



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660

Email: / Admin@qualitycontrol-iraq.com

QC-QA-MT-013 Rev.02Date SEP-2024

