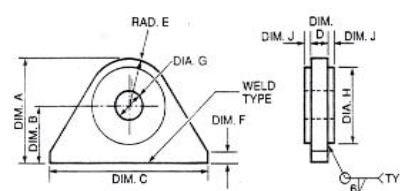





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-70
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
225C	01	Lifting Bracket Pad Eye MAST UPPER SECTION POWER TONG BRACKET		10 TON	20-10-2024
		Pad Eye Dimension Thickness: 30 MM Pin Hole: 38 MM Length: 150 MM Height: 150 MM Bracket Body Height: 350 MM Bracket Body Jaw Inside Width: 175 MM Bracket Body Pin Holes: 82 MM Bracket Pins: 79 MM		Last Proof Load Test:- 05-06-2023 BY GAMMA 	
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		YES	NO	Was the examination carried out: Within an interval of 6 months?	
				YES	
If the answer to the above question is YES has the equipment been installed correctly?		YES	NO	With an interval of 12 months?	
				YES	
				In accordance with an examination scheme?	
				YES	
				After the occurrence of exceptional circumstances?	
				YES	
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) NONE					
Is the above a defect which is of immediate danger to persons:				YES	NO
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?					
				YES	NO
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:		
Mahmoud Ali	Mohamed Abdullah		12-09-2025		

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-70A
Unit Serial Number	Description of the examined equipment				Result
225C	MAST UPPER SECTION POWER TONG BRACKET PAD EYE				Pass



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660

Email: / Admin@qualitycontrol-iraq.com

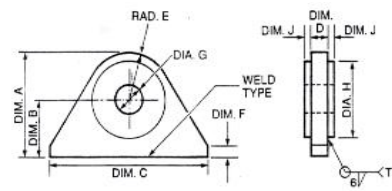

QC-QA-MT-013 Rev.02Date SEP-2024





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-71
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
225A	01	Lifting Bracket Pad Eye MAST UPPER SECTION POWER TONG BRACKET		10 TON	20-10-2024
		Pad Eye Dimension Thickness: 30 MM Pin Hole: 38 MM Length: 150 MM Height: 150 MM Bracket Body Height: 350 MM Bracket Body Jaw Inside Width: 175 MM Bracket Body Pin Holes: 82 MM Bracket Pins : 79 MM		Last Proof Load Test:- 05-06-2023 BY GAMMA 	
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/>		Was the examination carried out: Within an interval of 6 months? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> With an interval of 12 months? <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> In accordance with an examination scheme? After the occurrence of exceptional circumstances? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>	
If the answer to the above question is YES has the equipment been installed correctly?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/>		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/>	
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) NONE					
Is the above a defect which is of immediate danger to persons:				<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				<input type="checkbox"/> YES <input checked="" type="checkbox"/> <input type="checkbox"/> NO <input type="checkbox"/>	
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:		Date of Next Through Examination:	
Mahmoud Ali	Mohamed Abdullah			12-09-2025	

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660
 Email: / Admin@qualitycontrol-iraq.com
 QC-QA-MT-013 Rev.02Date SEP-2024





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-71A
Unit Serial Number	Description of the examined equipment				Result
225A	MAST UPPER SECTION POWER TONG BRACKET PAD EYE				Pass



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure


Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660

Email: / Admin@qualitycontrol-iraq.com

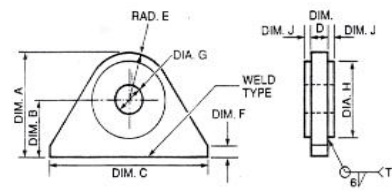

QC-QA-MT-013 Rev.02Date SEP-2024





Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-72
Serial Number:	QTY	Description		SWL	Date of last Thorough examination
225B	01	Lifting Bracket Pad Eye MAST UPPER SECTION POWER TONG BRACKET		10 TON	20-10-2024
		Pad Eye Dimension Thickness: 30 MM Pin Hole: 38 MM Length: 150 MM Height: 150 MM Bracket Body Height: 350 MM Bracket Body Jaw Inside Width: 175 MM Bracket Body Pin Holes: 82 MM Bracket Pins : 79 MM		Last Proof Load Test:- 05-06-2023 BY GAMMA 	
Reference Standard:		LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/>		Was the examination carried out: Within an interval of 6 months? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/> With an interval of 12 months? <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> <input type="checkbox"/> In accordance with an examination scheme? After the occurrence of exceptional circumstances? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input checked="" type="checkbox"/>	
If the answer to the above question is YES has the equipment been installed correctly?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/>		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> <input type="checkbox"/>	
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) NONE					
Is the above a defect which is of immediate danger to persons:				<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> <input type="checkbox"/>	
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A	
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
IS THIS EQUIPMENT SAFE TO OPERATE?				<input type="checkbox"/> YES <input checked="" type="checkbox"/> <input type="checkbox"/> NO <input type="checkbox"/> <input type="checkbox"/>	
NDT Equipment Details					
Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026
NDT procedure					
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect:					
None					
Particulars of any repair, renewal or alteration required to remedy the defect identified above:					
None					
ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp		Date of Next Through Examination:	
Mahmoud Ali	Mohamed Abdullah			12-09-2025	

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client Name:	Daqing Drilling Company	Location:	Rig (DQ 1202)	Job Number:	QC-B-03-25-0090
Date of Examination:	13-03-2025	Date of Report:	13-03-2025	Certificate No:	QC-B-03-25-0090-04-72A
Unit Serial Number	Description of the examined equipment				Result
225B	MAST UPPER SECTION POWER TONG BRACKET PAD EYE				Pass



NDT Equipment Details

Standard	ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. May.2025
White Contrast	WCP-2	Batch No:	220602	Due Date	April.2026
Black Ink	7HF	Batch No:	220605	Due Date	Jun.2026

NDT procedure

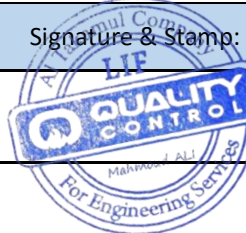
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect:

None

Particulars of any repair, renewal or alteration required to remedy the defect identified above:

None

ASNT Level II Inspector Name:	Name of person authenticating:	Signature & Stamp:	Date of Next Through Examination:
Mahmoud Ali	Mohamed Abdullah		12-09-2025

THIS IS TO CERTIFY THAT; a competent person did attend the above-mentioned owner's work location on the date shown above and the equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.

Contact Us: +9647810009138 +9647834964660

Email: / Admin@qualitycontrol-iraq.com

QC-QA-MT-013 Rev.02Date SEP-2024

