


MPI & Wall Thickness Inspection Certificate

Client:	SLB BASRA	Report No:	QC-SLB-25181-40
Work Location:	WIRELINE WORKSHOP	Date Of Inspection:	12/Jul/2025
Reference:	Customer spec ASTM E797+E709	Next Inspection Date:	11/Jan/2026

Specification:	☐ API ☐ DS1 ☒ Customer spec ☐ Other	
Inspection method:	☒ MPI ☐ Wet ☐ Dry ☐ Dye Penetrant ☐ VTI ☒ Ultrasonic wall thickness spot test ☐ Others	
Equipment used:	☐ UVB light ☐ AC yoke ☐ DC coil ☒ Ultrasonic T.G. ☐ Other	

Material Inspected:	Grease Injection control head 4"	OD:	2.005 in	ID:	1 10/32
---------------------	----------------------------------	-----	----------	-----	---------

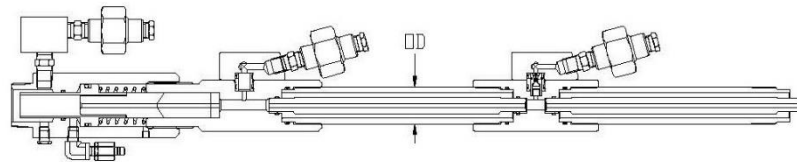

Serial No.	Ultrasonic Thickness Measurements				Minimum Thickness
ZH045	0.389 in	0.379 in	0.375 in	0.315 in	0.243 in

Inspection Evaluation:	U.T	During All the Reading Are Within the Tolerance. Accepted Min Thickness According to Schlumberger Reference.
	MPI	Magnetic Particle Inspection Was Carried Out and Found Free from Surface Cracks. Accepted

Inspection Equipment Details:	U.T Wall Thickness	Serial No	14526	Cal Date	24.Feb.2025
-------------------------------	--------------------	-----------	-------	----------	-------------

Min = Minimal W. T	TE=Thread Elongation	CO= Corrosion	W = Washout	M = Flat Spot / Mash	SD= shoulder Damage
--------------------	----------------------	---------------	-------------	----------------------	---------------------

SUPERVISOR	M-TAREK	Inspector	Bilal Akram
------------	---------	-----------	-------------

