


MPI & Wall Thickness Inspection Certificate

Client:	SLB BASRA	Report No:	QC-SLB/25179-43
Work Location:	SLIK LINE WORK SHOP UNIT 3	Date Of Inspection:	08/Jul/2025
Reference:	Customer spec ASTM E797	Next Inspection Date:	07/Jan/2026

Specification:	☐ API ☐ DS1 ☒ Customer spec ☐ Other	
Inspection method:	☒ MPI ☐ Wet ☐ Dry ☐ Dye Penetrant ☐ VTI ☒ Ultrasonic wall thickness spot test ☐ Others	
Equipment used:	☐ UVB light ☒ AC yoke ☐ DC coil ☒ Ultrasonic T.G. ☐ Other	

Material Inspected:	TOOL TRAP 4"	OD:	5.26 Inch	ID:	4 Inch
----------------------------	---------------------	------------	------------------	------------	---------------

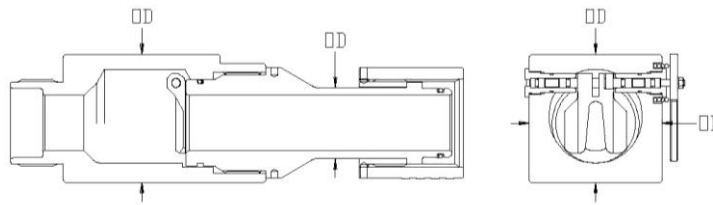

Serial No.	Ultrasonic Thickness Measurements				Minimum Thickness
YA096	0.575 in	0.577 in	0.578 in	0.584 in	0.483 In

Inspection Evaluation:	U.T	During All The Reading Are Within The Tolerance. Accepted Min Thickness According to Schlumberger Reference.
	MPI	Magnetic Particle Inspection Was Carried Out And Found Free From Surface Cracks. Accepted

Inspection Equipment Details:	U.T Wall Thickness	AC/Yoke	White Contrast MAGNAFLUX	Black Magnetic Ink MAGNAFLUX
	SN: 5202746 CAL.DUE 23-Aug-2025	SN:201504046 CAL. DUE 23-Aug-2025	PN:220301 Exp.Dt May-2026	PN: 220309 Exp.Dt May-2026

Min = Minimal W. T	TE=Thread Elongation	CO= Corrosion	W = Washout	M = Flat spot / Mash	SD= shoulder Damage
---------------------------	-----------------------------	----------------------	--------------------	-----------------------------	----------------------------

SUPERVISOR	M-TAREK	Inspector	Bilal Akram
-------------------	----------------	------------------	--------------------

