



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Aberdeen Technical Service Company	Certificate no:	QC-B-08-26-184/01
Location:	Aberdeen Yard	Job Order No.:	QC-B-08-26-184
Date of Examination:	10/Aug/2026	Next Inspection Due:	09/Aug/2027
Equipment Serial No:	8210149	Last Proof Load Test Date:	07/July/2023
S.W. L:	130 ton	Last Inspection Date:	24/Aug/2025
Description of Equipment	Diesel Operated Hydraulic Telescopic Boom Mobile Crane 130 Ton SWL @ 2.5 m. Radius & 11.8 M. Boom Length, on Full Parts Line and Fully Extended Five Outrigger 50 Ton SWL @ 7.0 m Radius & 19.8 m Boom Length at time of inspection Manufacturer / Date: Kato / 2020 Chasses No: KA5153-3064 Model: KA-1300SL Basic Boom Length: 11.08M to 52.0 M Max Radius: 46.0 M Main Hoist S/N: 72658 SWL: 50Ton, Wire rope: 20 MM Auxiliary Hoist S/N: 72658 SWL: 7.8 Ton, Wire rope: 20 MM Registration No: 14 A 2020		
Ref. Standard	BS 7121-3:2017+A1:2019		

Main Block	No. of Falls	Radius	Boom Length	SWL	Load Applied (Ton)
	7	7.0 m	19.8 m	50.0 Ton	Function Test
		10.0 m	19.8 m	35.5 ton	Function Test
		12.0 m	19.8 m	28.5 ton	27.5 Ton (Performance Test)
Aux. Line	1	26.0 m	52.0 m	7.9Ton	function Test

Examination Type	Pass	Fail	Notes
Function (No Load)	☒		Mobile Crane Found Satisfactory for Further Use.
Performance Test (Rated Capacity)	☒		Mobile Crane was found to be acceptable for lifting 100 % from SWL.
Proof Load Test (1.25 x Rated Capacity)	---		Proof Load Test Shall Be Done After any Repair/ Modification

Is this the first examination after installation or assembly at a new site or location?	YES		NO	✓	Was the examination carried out:				
					Within 6 months?	YES		NO	✓
If the answer to the above question is YES has the equipment been installed correctly?	YES		NO		Within 12 months?	YES	✓	NO	
					By an examination scheme?	YES	✓	NO	
					After the occurrence of exceptional circumstances?	YES		NO	✓

Identification of any part found to have a defect which is or could become a danger to persons and a description of the defect: (If none state NONE)
None (The load indicator only displays the operational capacity)

Is the above a defect which is of immediate danger to persons

Is the above a defect that is not yet but could become a danger to persons: (If YES state the date by when)

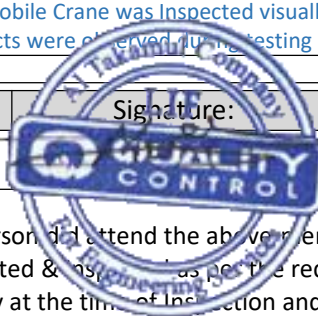
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None

Particulars of Any Tests Carried Out as Part of The Examination: (If None State NONE)

In the light of inspection findings, the subject Mobile Crane was Inspected visually, and operationally and a Function test & MPI of the Main Hook and Auxiliary Hook. were performed where no defects were observed during testing Hence, it was found satisfactory and fit for the intended use.

Is This Equipment Safe to Operate?

Yes, Accept ✓ NO Reject

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdalla		Ashraf El Said	

THIS IS TO CERTIFY THAT: a competent person, did attend the above mentioned owner's work location on the date shown above and the Equipment described in this report was tested & inspected in accordance with the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.

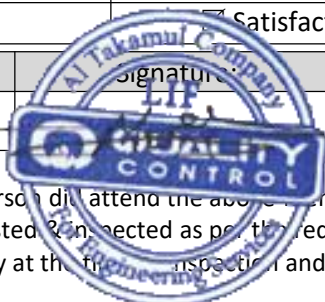


Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Aberdeen Company	Location:	Aberdeen Yard	Certificate No:	QC-B-08-26-184/01
Date of Examination:	10/Aug/2026	S.W.L:	130 ton	Serial No:	8210149

Components	Satisfactory	Comments
STRUCTURE		
Structure & Data Plate	☒ Satisfactory	
Slew Bearing Turn Freely/ Mechanism	☒ Satisfactory	
Chassis	☒ Satisfactory	
Crane Tires & Nuts	☒ Satisfactory	
Outriggers		
Hoses	☒ Satisfactory	
Extension rams	☒ Satisfactory	
Interlocking system	☒ Satisfactory	
Connecting Bolts and pins	☒ Satisfactory	
Levelling system	☒ Satisfactory	
Paintwork	☒ Satisfactory	
Outrigger pads	☒ Satisfactory	
Boom		
Condition	☒ Satisfactory	
Hydraulic hoses	☒ Satisfactory	
Extension rams	☒ Satisfactory	
Extension Interlocks	☒ Satisfactory	
Boom main hoist ram	☒ Satisfactory	
Main hoist ram footprint	☒ Satisfactory	
Jib, Boom, Boom Extension, Turret	☒ Satisfactory	
Counter Weight:		
Ballast weights pick up rams	☒ Satisfactory	
Hydraulic hoses	☒ Satisfactory	
Operation	☒ Satisfactory	
Ballast weights	☒ Satisfactory	
Electrics		
Switchgear and panels	☒ Satisfactory	
Connections/wiring	☒ Satisfactory	
Operations	☒ Satisfactory	
AUTOMATIC SAFE LOAD INDICATORS AND LIMIT SWITCHES		
Radius/ Boom/ Angle Indicators	☒ Satisfactory	
Safe Load Indicator & Overload Limit Switch	☒ Satisfactory	
Audible & Visual Alarms are operative	☒ Satisfactory	
Anti-Two Block Switches Operation	☒ Satisfactory	
Position and visibility	☒ Satisfactory	

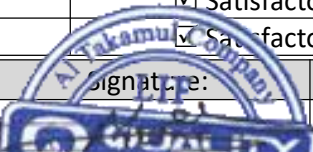
LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdalla		Ashraf El Said	

THIS IS TO CERTIFY THAT: a competent person did attend the above mentioned owner's work location on the date shown above and the Equipment described in this report was tested & connected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Aberdeen Company	Location:	Aberdeen Yard	Certificate No:	QC-B-08-26-184/01
Date of Examination:	10/Aug/2026	S.W.L:	130 ton	Serial No:	8210149
Components		Satisfactory		Comments	
HYDRAULIC SYSTEM					
Flexible Hoses and Hose Connections		☑ Satisfactory			
Hydraulic Cylinder		☑ Satisfactory			
Hydraulic Cylinder Fittings		☑ Satisfactory			
Hydraulic Filter		☑ Satisfactory			
Pump Condition		☑ Satisfactory			
Oil Seepage/ Leakage		☑ Satisfactory			
WIRE ROPES/ FITTINGS/ HOOK BLOCKS/ SHEAVES/ DRUM					
Wire Rope Condition		☑ Satisfactory			
Rope Reeving on Drum		☑ Satisfactory			
Drum Condition		☑ Satisfactory			
MAIN Hook Block		☑ Satisfactory			
Hook Safety Latch		☑ Satisfactory			
Sheaves		☑ Satisfactory			
Wedge Socket & Dead-End Anchorage Point		☑ Satisfactory			
Boom Angle Indicator		☑ Satisfactory			
OPERATOR CABIN & GENERAL					
Cabin condition		☑ Satisfactory			
Visibility		☑ Satisfactory			
Seating		☑ Satisfactory			
Heat and ventilation		☑ Satisfactory			
Manufactures rating charts		☑ Satisfactory			
Access and egress		☑ Satisfactory			
Control markings		☑ Satisfactory			
Control operation		☑ Satisfactory			
Windscreen wipers		☑ Satisfactory			
Fire Extinguisher Availability		☑ Satisfactory			
OPERATIONAL TEST					
Hoisting Up & Down		☑ Satisfactory			
Boom Extraction and Subtraction		☑ Satisfactory			
Boom Raising and Lowering		☑ Satisfactory			
Slewing Operation & Alarm		☑ Satisfactory			
Drum Operation		☑ Satisfactory			
Levers Operation (In Operator Cabin)		☑ Satisfactory			
Reverse Alarm & Operation		☑ Satisfactory			
Lights, Horn & Indicators		☑ Satisfactory			
LEEA & ASNT Level II Inspector Name:		Signature:		Authenticating This Report:	
Mohamed Abdalla				Ashraf El Said	

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above and the Equipment described in this report was tested & inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Aberdeen Company	Location:	Aberdeen Yard	Certificate No:	QC-B-08-26-184/01
Date of Examination:	10/Aug/2026	S.W.L:	130 ton	Serial No:	8210149

Test Methods:	Result	COMMENTS
VT	☒ Accept	MPI of Main Hook & Auxiliary Hook
MT	☒ Accept	
Functional Test	☒ Accept	
Performance Test	☒ Accept	
Proof Load Test {1.25 X SWL}	-----	
Functional Test		
Carried out without load on all functions (including brakes and safety devices) and controls to check the correct and smooth equipment operation, free from wear and other damage.		
Performance Test		
Carried out after Functional Test and with the rated load (SWL) applied where Hoist brakes were found satisfactory.		
Proof Load Test		
Carried out after Performance Test and with the 1.25 x (SWL) applied load where Hoist brakes were found satisfactory.		

LEEA & ASNT Level II Inspector Name:	Signature	Authenticating This Report:	Signature:
Mohamed Abdalla		Ashraf El Said	

THIS IS TO CERTIFY THAT: a competent person did attend the above-mentioned owner's work location on the date shown above and the Equipment described in this report was tested & inspected as per the requirement of Lifting Operations Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and considered Safe for Lifting.



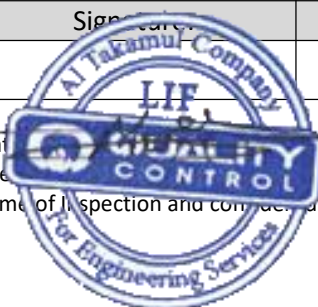
Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdalla		Ashraf ElSaid	

THIS IS TO CERTIFY THAT: a competent person did a thorough examination and NDT of the lifting equipment at the work location on the date shown above and the Equipment described in this report was tested & inspected as per the requirements of the Lifting Equipment Regulation "LOLER". The result was found Satisfactory at the time of inspection and confirmed Safe for Lifting.





Certificate of Thorough Examination & NDT for Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations



D.1	اللون	E	KA81533064
D.3	العلامة التجارية	11	2014
D.4	العلامة التجارية	12	اعتماد
D.5	العلامة التجارية	13	1/0
D.6	العلامة التجارية	14	0 kg
D.7	العلامة التجارية	15	0 kg
D.8	العلامة التجارية	16	0 kg
D.9	العلامة التجارية	17	4442 com
D.10	العلامة التجارية	18	0 km/h
D.11	العلامة التجارية	19	0
D.12	العلامة التجارية	20	0
D.13	العلامة التجارية	21	0
D.14	العلامة التجارية	22	0
D.15	العلامة التجارية	23	0
D.16	العلامة التجارية	24	0
D.17	العلامة التجارية	25	0
D.18	العلامة التجارية	26	0
D.19	العلامة التجارية	27	0
D.20	العلامة التجارية	28	0
D.21	العلامة التجارية	29	0
D.22	العلامة التجارية	30	0
D.23	العلامة التجارية	31	0
D.24	العلامة التجارية	32	0
D.25	العلامة التجارية	33	0
D.26	العلامة التجارية	34	0
D.27	العلامة التجارية	35	0
D.28	العلامة التجارية	36	0
D.29	العلامة التجارية	37	0
D.30	العلامة التجارية	38	0
D.31	العلامة التجارية	39	0
D.32	العلامة التجارية	40	0
D.33	العلامة التجارية	41	0
D.34	العلامة التجارية	42	0
D.35	العلامة التجارية	43	0
D.36	العلامة التجارية	44	0
D.37	العلامة التجارية	45	0
D.38	العلامة التجارية	46	0
D.39	العلامة التجارية	47	0
D.40	العلامة التجارية	48	0
D.41	العلامة التجارية	49	0
D.42	العلامة التجارية	50	0
D.43	العلامة التجارية	51	0
D.44	العلامة التجارية	52	0
D.45	العلامة التجارية	53	0
D.46	العلامة التجارية	54	0
D.47	العلامة التجارية	55	0
D.48	العلامة التجارية	56	0
D.49	العلامة التجارية	57	0
D.50	العلامة التجارية	58	0
D.51	العلامة التجارية	59	0
D.52	العلامة التجارية	60	0
D.53	العلامة التجارية	61	0
D.54	العلامة التجارية	62	0
D.55	العلامة التجارية	63	0
D.56	العلامة التجارية	64	0
D.57	العلامة التجارية	65	0
D.58	العلامة التجارية	66	0
D.59	العلامة التجارية	67	0
D.60	العلامة التجارية	68	0
D.61	العلامة التجارية	69	0
D.62	العلامة التجارية	70	0
D.63	العلامة التجارية	71	0
D.64	العلامة التجارية	72	0
D.65	العلامة التجارية	73	0
D.66	العلامة التجارية	74	0
D.67	العلامة التجارية	75	0
D.68	العلامة التجارية	76	0
D.69	العلامة التجارية	77	0
D.70	العلامة التجارية	78	0
D.71	العلامة التجارية	79	0
D.72	العلامة التجارية	80	0
D.73	العلامة التجارية	81	0
D.74	العلامة التجارية	82	0
D.75	العلامة التجارية	83	0
D.76	العلامة التجارية	84	0
D.77	العلامة التجارية	85	0
D.78	العلامة التجارية	86	0
D.79	العلامة التجارية	87	0
D.80	العلامة التجارية	88	0
D.81	العلامة التجارية	89	0
D.82	العلامة التجارية	90	0
D.83	العلامة التجارية	91	0
D.84	العلامة التجارية	92	0
D.85	العلامة التجارية	93	0
D.86	العلامة التجارية	94	0
D.87	العلامة التجارية	95	0
D.88	العلامة التجارية	96	0
D.89	العلامة التجارية	97	0
D.90	العلامة التجارية	98	0
D.91	العلامة التجارية	99	0
D.92	العلامة التجارية	100	0