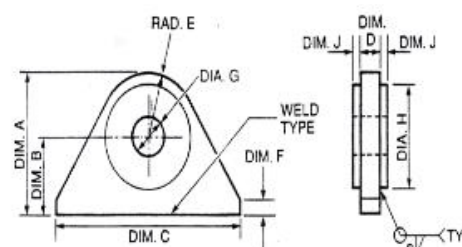




Certificate of Through Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-03
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22-Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number:	QTY	Description	Pad Eye SWL:	Date of Last Through Examination
H23 H24	02	Fabricated Pad Eyes Pad Eye Dimension Thickness: 21 mm Pin Hole: 21 mm Length: 150 mm Height: 90 mm Location: V-DOOR PATEFORM SUPPORT BEAM	8 KN	NEW
				

Reference Standard:	LEEA DOC 048:2015
---------------------	-------------------

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within 6 months?	YES	NO	✓
				With an interval of 12 months?	YES	NO	✓
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO	✓	By an examination scheme?	YES	NO	✓
				After the occurrence of exceptional circumstances?	YES	NO	✓

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO ✓

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) YES by:

Particulars of any repair, renewal, or alteration required to remedy the defect identified above:

Particulars of any tests carried out as part of the examination: (If none state NONE)

VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY

IS THIS EQUIPMENT SAFE TO OPERATE? YES ✓ NO

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Coloured Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	May.2028
Black Ink	7HF	Batch No:	008A103	Due Date	June.2028

NDT procedure	
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect: None	
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None	

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-04
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number	Description of the examined equipment: V-DOOR PATEFORM Support Beam Pad Eyes & WELDING AREAS			Result
Pad Eyes S/N:	H23&H24	SWL:	8 KN	Accept



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-11	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2028
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

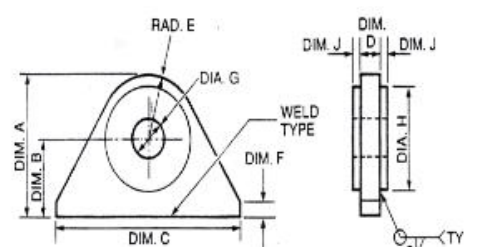




Certificate of Through Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-05
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22-Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number:	QTY	Description	Pad Eye SWL:	Date of Last Through Examination
H6 H7 H8 H9	04	Fabricated Pad Eyes Pad Eye Dimension Thickness: 21 mm Pin Hole: 30 mm Length: 125 mm Height: 135 mm Location: RIG FLOOR PLATES	8 KN 	NEW

Reference Standard:	LEEA DOC 048:2015		
Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓
If the answer to the above question is YES has the equipment been installed correctly?	YES	✓	NO
Was the examination carried out: Within 6 months? With an interval of 12 months? By an examination scheme? After the occurrence of exceptional circumstances?	YES	✓	NO
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE)	NONE		
Is the above a defect which is of immediate danger to persons:	YES	NO	✓
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)	YES by:		
Particulars of any repair, renewal, or alteration required to remedy the defect identified above:			
Particulars of any tests carried out as part of the examination: (If none state NONE)	VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY		
IS THIS EQUIPMENT SAFE TO OPERATE?	YES	✓	NO

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Coloured Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	May.2028
Black Ink	7HF	Batch No:	008A103	Due Date	June.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-06
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number	Description of the examined equipment: RIG FLOOR PLATES PAD EYES			Result
Pad Eyes S/N:	H6,H7,H8&H9	SWL:	8 KN	Accept



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-11	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2028
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

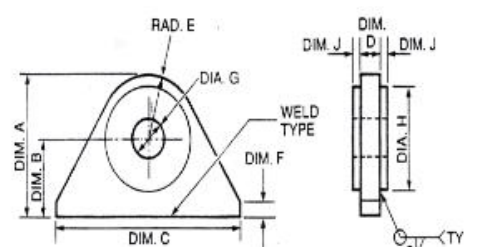




Certificate of Through Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-07
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22-Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number:	QTY	Description	Pad Eye SWL:	Date of Last Through Examination
H10 H11 H12 H13	04	Fabricated Pad Eyes Pad Eye Dimension Thickness: 21 mm Pin Hole: 30 mm Length: 125 mm Height: 135 mm Location: RIG FLOOR PLATES	8 KN 	NEW

Reference Standard:	LEEA DOC 048:2015												
Is this the first examination after Installation or assembly at a new site or location?					Was the examination carried out: Within 6 months? With an interval of 12 months? By an examination scheme? After the occurrence of exceptional circumstances?								
	YES		NO	✓		YES	✓	NO					
						YES		NO	✓				
If the answer to the above question is YES has the equipment been installed correctly?	YES	✓	NO			YES	✓	NO					
						YES		NO	✓				
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) NONE													
Is the above a defect which is of immediate danger to persons:								YES		NO	✓		
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)						YES by:							
Particulars of any repair, renewal, or alteration required to remedy the defect identified above:													
Particulars of any tests carried out as part of the examination: (If none state NONE) VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY													
IS THIS EQUIPMENT SAFE TO OPERATE?								YES	✓	NO			

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Coloured Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	May.2028
Black Ink	7HF	Batch No:	008A103	Due Date	June.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-08
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number	Description of the examined equipment: RIG FLOOR PLATES PAD EYES			Result
Pad Eyes S/N:	H10,H11,H12&H13	SWL:	8 KN	Accept



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-11	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2028
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

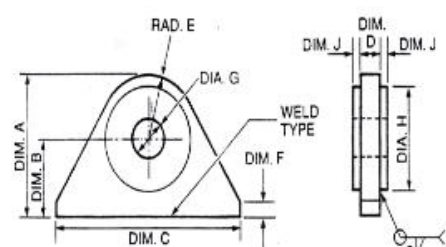




Certificate of Through Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-09
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22-Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number:	QTY	Description	Pad Eye SWL:	Date of Last Through Examination
H19 H20 H21 H22	04	Fabricated Pad Eyes Pad Eye Dimension Thickness: 21 mm Pin Hole: 30 mm Length: 125 mm Height: 135 mm Location: RIG FLOOR PLATES	8 KN 	NEW

Reference Standard: LEEA DOC 048:2015

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within 6 months?	YES	✓	NO	
				With an interval of 12 months?	YES		NO	✓
If the answer to the above question is YES has the equipment been installed correctly?	YES	✓	NO	By an examination scheme?	YES	✓	NO	
				After the occurrence of exceptional circumstances?	YES		NO	✓

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none state NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO ✓

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) YES by:

Particulars of any repair, renewal, or alteration required to remedy the defect identified above:

Particulars of any tests carried out as part of the examination: (If none state NONE)
VISUAL INSPECTION and MPI CARRIED OUT AND FOUND SATISFACTORY

IS THIS EQUIPMENT SAFE TO OPERATE? YES ✓ NO

NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Coloured Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	May.2028
Black Ink	7HF	Batch No:	008A103	Due Date	June.2028

NDT procedure

Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: None

Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

THIS IS TO CERTIFY THAT a competent person attended the above-mentioned owner's work location on the date shown above, and the equipment described in this report was tested and inspected as per the requirements of Lifting Operations Lifting Equipment Regulation "LOLER." The result was found Satisfactory at the time of Inspection and considered Safe for Lifting.





Visual & Magnetic Particles Examination Report

Client:	Hong Hua Oil& Gas Engineering Services Ltd	Certificate no:	QC-B-08-26-186-10
Location:	HH BASE (Rig HH-030)	Job Order No:	QC-B-08-26-186
Date of Examination:	22Aug-2026	Next Inspection Due:	21-Feb-2027

Serial Number	Description of the examined equipment: RIG FLOOR PLATES PAD EYES			Result
Pad Eyes S/N:	H19, H20, H21 & H22	SWL:	8 KN	Accept



NDT Equipment Details					
Standard	ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-11	Due Date	11. Nov.2026
White Contrast	WCP-2	Batch No:	008A009	Due Date	April.2028
Black Ink	7HF	Batch No:	008A103	Due Date	Jun.2028
NDT procedure					
Visual and MPI were carried out for the above description and found free of surface defects at the time of inspection					
Identification of any part found to have a defect and a description of the defect: None					
Particulars of any repair, renewal, or alteration required to remedy the defect identified above: None					

LEEA & ASNT Level II Inspector Name:	Signature:	Authenticating This Report:	Signature:
Mohamed Abdulla		Ashraf Elsaid	

